TM 9-4910-607-14 & P

DEPARTMENT
OF THE ARMY TECHNICAL MANUAL

OPERATOR, ORGANIZATIONAL, DIRECT SUPPORT
AND GENERAL SUPPORT MAINTENANCE
MANUAL INCLUDING REPAIR PARTS LIST

FOR

ADAPTER SET, ENGINE, ELECTRIC TEST
(SUN ELECTRIC CORPORATION)
(4910-00-348-7600)

HEADQUARTERS,
DEPARTMENT OF THE ARMY

APRIL 1978

Technical Manual

No. 9-4910-607-14&P

HEADQUARTERS
DEPARTMENT OF THE ARMY
Washington, DC, 12 April 1978

Operator, Organizational, Direct Support and General Support Maintenance Manual Including Repair Parts List

for

ADAPTER SET, ENGINE ELECTRIC TEST
(NSN 4910-00-348-7600, MODEL WPW-10)

REPORTING OF ERRORS

You can help improve this manual by calling attention to errors and by recommending improvements and by stating your reasons for the recommendations. Your letter or DA Form 2028 (Recommended Changes to Publications and Blank Forms) should be mailed direct to Commander, US Army Armament Materiel Readiness Command, ATTN: DRSAR-MAS, Rock Island, IL 61299. A reply will be furnished direct to you. For your convenience, preaddressed DA Form 2028's are included as final pages of this manual.

	Paragraphs	Page
Introduction	1	1
Connection Procedures for Changing circuit	2	1
Ignition Circuit Tests	3	2
Care of Adapter Set	4	5

NOTE

This manual is published for the purpose of identifying an authorized commericial manual for the use of the personnel to whom the adapter set is issued.

Manufactured by: Sun Electric Corporation
Chicago, IL 60631

Procured under Contract No: DAAA09-75-C-6785

1. Introduction.

a. The adapter set, no. WPW-10, (NSN 4910-00-348-7600) is for use in making test connections to 24-volt waterproof electrical systems in use on wheeled vehicles.

b. It consists of the following five adapters:

(1) Generator Adpt. (NSN 4910-00-092-9026)

(2) Regulator Adpt. (NSN 4910-00-092-9025)

(3) High Tension Adpt. (NSN 4910-00-356-7504)

(4) Ignition Unit Adpt. (NSN 4910-00-356-7492)

(5) Dist. Pri. Adpt. (NSN 4910-00-356-7492)

2. Connection procedure for Charging Circuit.

a. Generator Adapter.

(1) Disconnect generator cable at generator and plug generator adapter into socket.

(2) Reconnect generator cable to free end of generator adapter (fig 1).

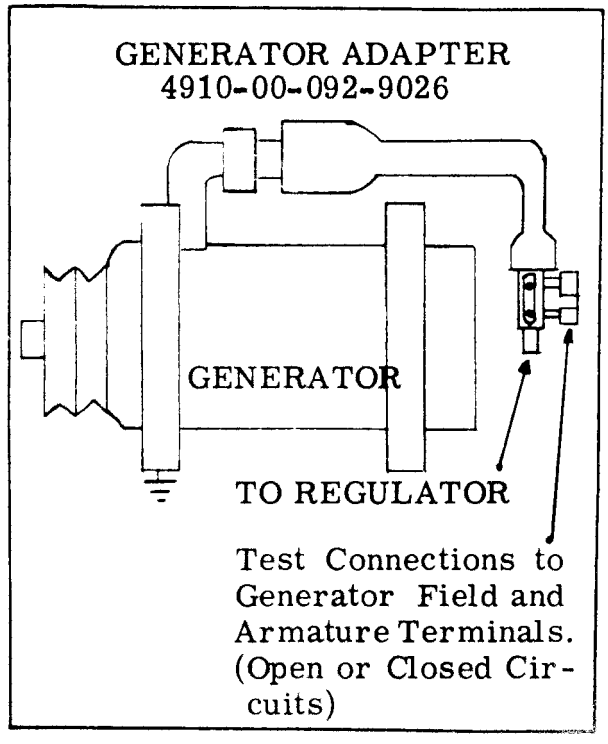

Figure 1. Generator adapter (4910-00-092-9026).